

STC-CMC2MPOE (2Meg, Color)
STC-CMB2MPOE (2Meg, B/W)
STC-CMB2MPOE-IR (2Meg, Near IR)
STC-CMC4MPOE(4Meg, Color)
STC-CMB4MPOE (4Meg, B/W)
STC-CMB4MPOE-IR (4Meg, Near IR)

GigE Vision POE CMOS
Color / Monochrome Camera
Product Specifications



Safety Precautions





The lightning flash with arrowhead symbol, within an equilateral triangle, is intended to alert the user to the presence of uninsulated "dangerous voltage" within the product's enclosure that may be of sufficient magnitude to constitute a risk of electric shock to persons.



The exclamation point within an equilateral triangle is intended to alert the user to the presence of important operating and maintenance (servicing) instructions in the literature accompanying the appliance.

Warning:

This equipment generates and uses radio frequency energy and if not installed and used properly, I.e., in strict accordance with the instruction manual, may cause harmful interference to radio communications. It has been tested and found to comply with the limits for a Class A computing device pursuant to Subpart J of Part 15 of FCC Rules, which are designed to provide reasonable protection against such interference when operated in a commercial environment.

For Canada

For U.S.A

Warning:

This digital apparatus does not exceed the Class A limits for radio noise emissions from digital apparatus set out in the Radio Interference Regulations of the Canadian Department of Communications.

WARNING:

TO PREVENT FIRE OR SHOCK HAZARD, DO NOT EXPOSE THIS APPLIANCE TO RAIN OR MOISTURE.

Product Precautions

- Handle the camera with care. Do not abuse the camera. Avoid striking or shaking it. Improper handling
 or storage could damage the camera.
- Do not pull or damage the camera cable.
- During camera use, do not wrap he unit in any material. This will cause the internal temperature of the unit to increase.
- Do not expose the camera to moisture, or do not try to operate it in wet areas.
- Do not operate the camera beyond its temperature, humidity and power source ratings.
- While the camera is not being used, keep the lens or lens cap on the camera to prevent dust or contamination from getting in the CCD or filter area and scratching or damaging this area.
- Do not keep the camera under the following conditions:
 - In wet, moist, and high humidity areas
 - Under hot direct sunlight
 - In high temperature areas
 - Near an object that releases a strong magnetic or electric field
 - Areas with strong vibrations
- Use a soft cloth to clean the camera. Use pressured air spray to clean the surface of the glass. DO not scratch the surface of the glass.

Product Specifications 2 Ver .03



Copyright & Disclaimer

Sensor Technologies America, Inc. (DBA Sentech America) believes the contents and specifications of its website, catalog, documentation and ads are correct; however, Sentech America provides no representation or warranty regarding such information or product(s) contained therein. It is requested that Sentech America be given appropriate acknowledgement in any subsequent use of such work by a third party.

While every effort has been made to ensure that the details contained in Sentech America's website and all documentation are correct and up-to-date, Sentech America assumes no liability, legal or otherwise for any errors in listings, specifications, part numbers, process, software or model applications. Sentech America reserves the right to change specifications, product descriptions, product quality, pricing and application at any time without prior written or oral notice. Any party using such information assumes all risk for any and all damaged caused to themselves, a third party and/or property by virtue of incorrect information and/or failure of these products. By installing and/or using a Sentech America software development kit or other similar product and/or information obtained from Sentech America's website, catalog, documentation or ads, you hereby accept and understand these stated terms and conditions.



Contents

I. Introduction	5
II. Specifications	6-10
A. Electronic Specifications	6-7
1. STC-CMC2MPOE / STC-CMB2MPOE / STC-CMB2MPOE-IR	6
2. STC-CMC4MPOE / STC-CMB4MPOE / STC-CMB4MPOE-IR	7
B. Spectral Sensitivity Characteristics	8-9
1. STC-CMB2MPOE / STC-CMB4MPOE	8
2. STC-CMC2MPOE / STC-CMC4MPOE	8
3. STC-CMC2MPOE-IR / STC-CMC4MPOE-IR (Near IR Model)	9
C. Mechanical Specifications	10
D. Environmental Specifications	10
III. Connector Specifications	11-16
A. RJ45 Connector	11
B. Power-I/O Connector	12-16
Equivalent Circuit for the Input Pin of the I/O Connector	15
2. Typical Input Circuit	16
3. Typical Output Circuit	16
IV. Dimensions	17



I. Introduction

This document describes the specifications of the following cameras:

STC-CMC2MPOE (2M Color)

STC-CMB2MPOE (2M Monochrome)

STC-CMB2MPOE-IR (2M Near IR) STC-CMC4MPOE (4M Color)


STC-CMB2MPOE (4M Monochrome)

STC-CMB4MPOE-IR (4M Near IR)

A. Features

- CMOS (Global Shutter)
- GigE Interface
- Power over Ethernet Support

B. Naming Method

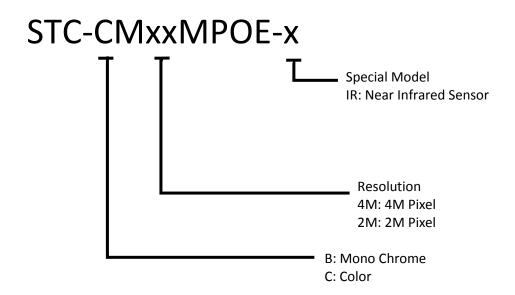



II. Specifications

A. Electronic Specifications

1. STC-CMC2MPOE / STC-CMB2MPOE / STC-CMB2MPOE-IR

Product		STC-CMC2MPOE	STC-CMB2 MPOE			
Imager		2/3" 2Meg color progressive CMOS	2/3" 2Meg monochrome progressive CMOS			
		(CMOSIS: CMV2000)	(CMOSIS: CMV2000)			
Shutter T	- уре	Global Shutter	Global Shutter			
Total Pict	ture Elements	2048 (H) >	(1088 (V)			
Active Pic	cture Elements	2048 (H) >	(1088 (V)			
Cell Size		5.5 (H) x 5	5.5 (V) μm			
Scanning	System	Progre				
		50 Hz at full resolution (25Hz on 10bi				
	requency	1.00000 to 780 Hz adjustal				
(Frame R	ate)	(Frame rate depends	- -			
		Maximum frame rate (780 Hz) is whe				
	al Frequency	58.1KHz (2TAP), 38.8KHz (1TAP)	58.1kHz			
Pixel Fred		150MHz (2TAP), 100MHz (1TAP)	150MHz			
Noise	@ 8bit output	≤ 3 Digit (0				
Level	@ 10bit output	≤ 12 Digit (Gain 0 dB)			
Minimum	n Scene Illumination	TBD Lux at F1.2	0.12 Lux at F1.2			
*Near	· IR (-NIR)	-	0.09 Lux at F1.2			
Sync. Sys	tem	Internal				
Video Output Format		Digital 8, 10 bit Raw data or	Digital 8, 10 bit Raw Data			
viaco ou	itput i oriniat	RGB 8 bit (Default:8bit Raw)	(Default:8bit Raw)			
Interface		IEEE802.3 (1	•			
Protocol		GigE Vision® 1.2				
		Preset continuous mode: 25 mic				
Exposure	Time	Preset trigger mode:25 micro				
		Pulse width mode: 25 micros				
ALC (Auto	omatic Light Control)	Automatic Exposure (AE) and Automatic Gain Control (Default: AE C				
Gain		x1 to x3 (D	·			
Gamma		Gamma 1.0 (Factory default) or up				
AOI Func	tion		Variable AOI setting via the communication			
	erpolation	Available on RGB Output (Default:ON)	N/A			
White Balance		Auto, Manual, Push to Set	•			
		White Balance are available N/A				
		on both raw data and RGB outputs (Default:OFF)	·			
Operatio	nal Mode	1 (Pulse width trigger (Default:OFF)			
Commun		UART communication				
1/0		One opt-isolated input and two open collector outputs(+3.3V)				
•	Input Voltage	+10.8 to +				
Power	Consumption					
	(Max/Default)	Less than TBD W				




2. STC-CMC4MPOE / STC-CMB4MPOE / STC-CMB4MPOE-IR

Product						
Imager		1" 4Meg color progressive CMOS	1" 4Meg monochrome progressive CMOS			
imagei		(CMOSIS: CMV4000)	(CMOSIS: CMV4000)			
Shutter Ty	' '	Global Shutter	Global Shutter			
Total Pictu	ure Elements	2048 (H) >				
Active Pict	ture Elements	2048 (H) >				
Cell Size		5.5 (H) x 5	5.5 (V) μm			
Scanning S	System	Progre				
		25 Hz at full resolution (12.5Hz on 10b				
Vertical Fr		1.00000 to TBD Hz adjustable via the communication				
(Frame Ra	ate)	(Frame rate depends				
		Maximum frame rate (TBD Hz) is whe	n vertical resolution AOI setting is 32.			
Horizonta	l Frequency	54.4	kHz			
Pixel Freq	uency	120	MHz			
Noise	@ 8bit output	≤ TBD Digit	(Gain 0 dB)			
Level	@ 10bit output	≤ TBD Digit	(Gain 0 dB)			
Minimum	Scene Illumination	TBD Lux at F1.2, 25Hz	TBD Lux at F1.2, 25 Hz			
*Near	IR (-NIR)	-	TBD Lux at F1.2, 25Hz			
Sync. Syst	em	Internal				
Video Output Format		Digital 8, 10 bit Raw data or	Digital 8, 10 bit Raw Data			
video Odi	tput Format	RGB 8 bit (Default:8bit Raw)	(Default:8bit Raw)			
Interface		IEEE802.3 (1	.000BASE-T)			
Protocol		GigE Vision® 1.2	genlCam™ 2.0			
		Preset continuous mode: 25 mic	croseconds to 2000 milliseconds			
Exposure	Time	Preset trigger mode:25 micro	seconds to 2000 milliseconds			
		Pulse width mode: 25 micros	seconds to 2000 milliseconds			
ALC (Auto	matic Light Control)	Automatic Exposure (AE) and Automatic Gain Control	(AGC) (ON/OFF) (adjustable via the communication)			
ALC (Auto	inatic Light Control)	(Default: AE C	OFF, AGC ON)			
Gain		x1 to x3 (D	efault: x1)			
Gamma		Gamma 1.0 (Factory default) or up	oloadable gamma table (Default:1)			
AOI Funct	ion	Variable AOI setting vi	ia the communication			
Color Interpolation		Available on RGB Output (Default:ON)	N/A			
White Balance		Auto, Manual, Push to Set				
		White Balance are available	N/A			
		on both raw data and RGB outputs (Default:OFF)				
Operation	nal Mode	Edge preset trigger, Pulse width trigger (Default:OFF)				
Communi	Communication UART communication through Ethernet port					
1/0		One opt-isolated input and two open collector outputs(+3.3V)				
Danner	+10.8 to +26.4 Vdc	+10.8 to +26.4 Vdc				
Power	Less than TBD W	Less than	n TBD W			




B. Spectral Sensitivity Characteristics

1. STC-CMB2MPOE / STC-CMB4MPOE

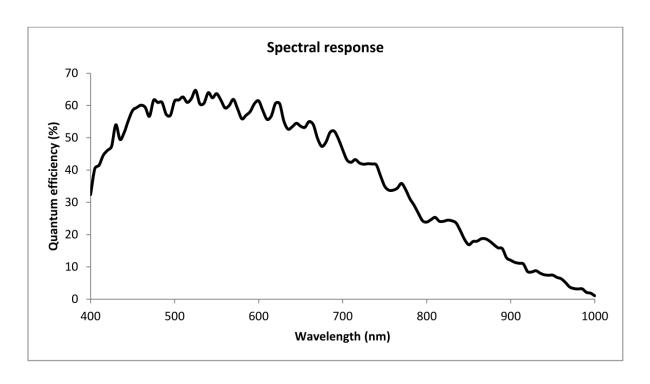


2. STC-CMC2MPOE / STC-CMC4MPOE

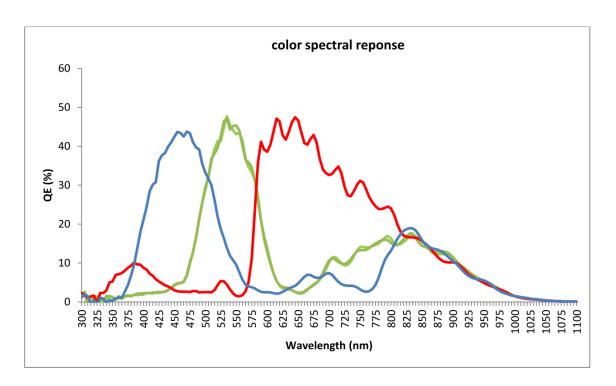



3. STC-CMB2MPOE-IR / CMB4MPOE-IR (Near IR Model)

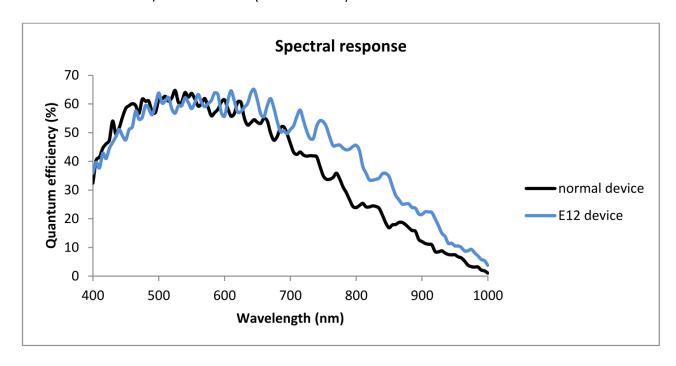



C. Mechanical Specifications

Model Number	STC-CMC2MPOE, STC-CMC2MPOE, STC-CMC4MPOE, STC-CMB4MPOE
Dimensions	35 (W) x 35 (H) x 55.9(D) mm excluding connectors
Optical Filter	No Filter
Optical Center Accuracy	Positional accuracy in H and V directions:: ± 0.3 mm Rotational accuracy of H and V: ± 1.0 deg
Material	Aluminum (AC)
Lens Mount	C mount
Connectors	RJ45 connector Power- I/O connector: HR10A-7R-6PB (Hirose) or equivalent
Camera Mount Screws	Two 1/4" Tripod screw holes: (One on each top and bottom plate), Twelve M4 screws holes: (Four on each top and bottom plate, two on each side plate)
Weight	TBD g


D. Environmental Specifications

Model Number		STC-CMC2MPOE,STC-CMB2MPOE, STC-CMC4MPOE,STC-CMB4MPOE	
Operational	Minimum	Environmental Temperature -5°C	
Temperature	N.4	Camera housing temperature (top plate) shall not exceed 65°C	
	Maximum	(This corresponds to an environmental temperature of approximately 35°C)	
Storage temperature		Environmental Temperature -30°C to 65°C	
Vibration		20Hz to 200Hz to 20Hz (5min./cycle), acceleration 10G, 3 directions 30 min. each	
Shock		Acceleration 38G, half amplitude 6ms, 3 directions 3 times each	
Standard Compliancy		EMS: EN61000-6-2, EMI: EN55011	
RoHS		RoHS Compliant	

Note: When the camera is used in surrounding temperatures that exceed 35°C, please make sure that the camera is set up to properly radiate heat (maintaining the camera's top case plate's temperature to be less than 65°C).



III. Connector Specifications

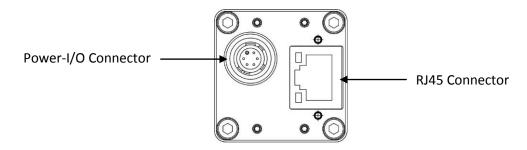


A. RJ45 Connector


This product is PoE compliant. Please supply power (+10.8 to +26.4Vdc) through the power-I/O connector when using non-PoE-compliant NIC.

Pin No.	Signal Name
1	TA+
2	TA-
3	TB+
4	TC+
5	TC-
6	TB-
7	TD+
8	TD-


Green LED	Yellow LED	Status
Green Light ON	Yellow Light ON	Power ON
Green Light ON	Yellow Light Blinking	1Gb Transferring
Light OFF	Yellow Light Blinking	100 Mb Transferring

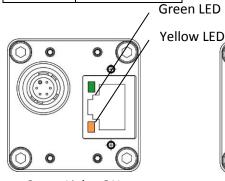

Green Light: ON Yellow Light: ON Power ON

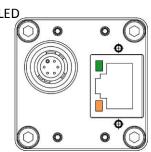

Green light: ON
Yellow light: Blinking
1 Gb Transferring

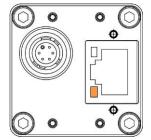

Green light: OFF Yellow light: Blinking 100 Mb Transferring

Please use a Gigabit compatible network interface card (NIC) and/or network switch and LAN cable. In such a case, please also confirm that NIC and/or network switch is operating at Gigabit speeds.


For the detail of Connection, please see "System Configurations (Example Connections)".



B. Power-I/O Connector

- ➤ HR10A-7R-6PB (Hirose) or equivalent
- > This connector is for the power supply (12Vdc) and input /output signals.
- ➤ Use HR10A-7P-6S (Hirose) or equivalent for the cable side.

Pin No.	Signal Name	IN / OUT	Voltage
1	GND	IN	0V
2	I/O-1	OUT	Open Collector
3	1/0-2	OUT	Open Collector
4	TRG_In- (Opt. Isolated -)	IN	Low: Smaller than +1.0V High: +3.0 to +26.4V
5	TRG_In+ (Opt. Isolated +)	IN	*potential difference between TRG_In- and TRG_In+
6	POWER IN	IN	+10.8 to +26.4 Vdc

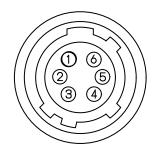

Output signals can be assigned through the camera setting communication.
 (Device Code = 00H, Command = F0H and F1H)



Output pin can be assigned through register setting or GenlCam Command.

Command No.				GenlCam command
F0H[30]	F1[3]	F0H[74]	F1[4]	1/0 1 (Din No 2) /1/0 2 (Din No 2)
For I/O-1	For I/O-1 (Pin No. 2)		(Pin No.3)	I/O-1 (Pin No.2) / I/O-2 (Pin No.3)
OH (initial setting)	-	0H	-	FrameTriggerWait (initial setting for I/O-1)
1H	Set Value	1H	Set Value	UserOutput
2H	-	2H (initial setting)		ExposureActive (initial setting for I/O-2)
3H	-	3H	-	TriggerAuxiliary
4H	-	4H		TriggerInternal
5H	-	5H		SensorReadOut
6H	-	6H		StrobeSignal
7H-FH	-	7H-FH	-	For Test Use Only

Note: I/O-1 can be assigned only by F0H[3..0] and F1[3], and I/O-2 can be assigned only by F0H[7..4] and F1[4].

1)FrameTriggerWait

The user can check the camera condition (camera exposure and image output processing by the trigger signal with this FrameTriggerWait signal).

This signal is LOW for the period from the trigger input signal to the image output.

The camera default setting is the input trigger signal is INVALID while at the low status of this signal. When the exposure starts while the image output by the next trigger signal, please change the camera setting (Device code: 00H, Command No. :13H) to accept the trigger signal while the image outputs.

The noise appears on the image when the start exposure while the image is output. In this case, please change the "H reset" for the exposure start mode (Device code: 00H, Command No.: 12H) to change the exposure start point to the next HD timing.

2) UserOutput

The status of the UserOutput signal can change with the "UserOutputValue".

3) ExposureActive

The user can check the exposure time with the ExposureActive signal.

4) TriggerAuxiliary

The TriggerAuxiliary signal is the input trigger signal.

Product Specifications 13 Ver .03



5) TriggerInternal

The TriggerInternal signal is the input trigger signal with the trigger delay time.

6) SensorReadOut


The SensorReadOut signal is the FVAL signal, which is the image output period of the time.

7) StrobeSignal

The StrobeSignal signal is the strobe control signal.




1. Equivalent Circuit for the Input Pin of the I/O Connector

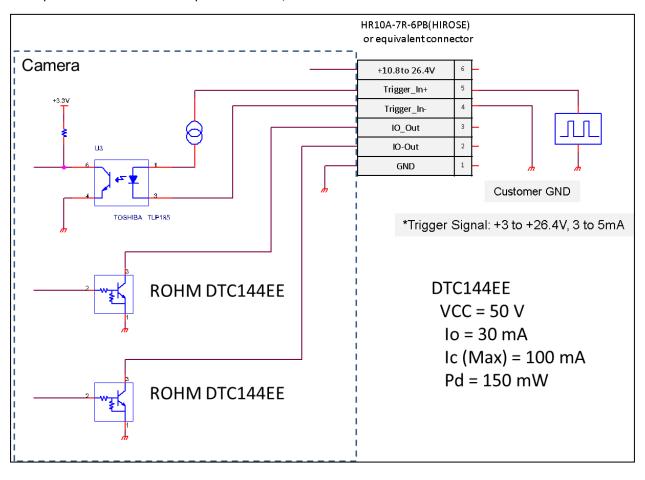




2. Typical Input Circuit

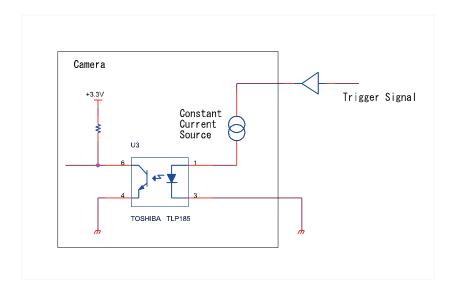


3. Typical Output Circuit

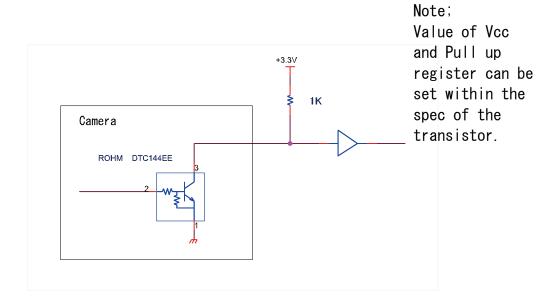



IV. Dimensions

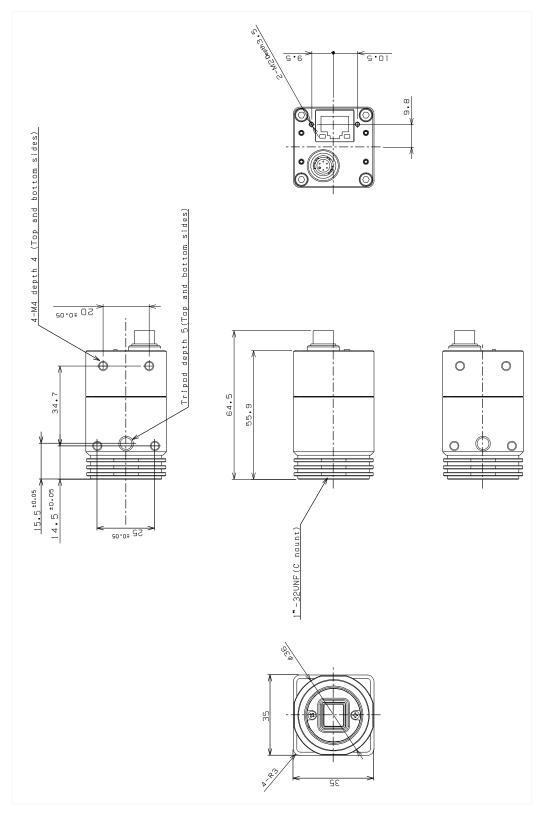

Unit: mm



Revisions

Rev	Date	Changes	Note
.02	September 19, 2013	Update	
		Adjusted to a new model.	
.03	September 20, 2013	Update	
	•	Dimensions Revised	



Sensor Technologies America, Inc.

1345 Valwood Pkwy, Suite 320 Carrollton, Texas 75006-6891 TEL (972) 481-9223 FAX (972) 481-9209 URL http://www.sentechamerica.com/

Sensor Technology Co., Ltd.

7F, Harada Center Building 9-17, Naka cho 4chrome Atsugi-city, Kanagawa 243-0018 Japan TEL +81-46-295-7061 FAX +81-46-295-7066 URL http://www.sentech.co.jp/

Taiwan Sensor Technology, Inc.

3F-6, No. 9, Aiguo W, Rd,. Jhong Jheng District Taipei City 100, Taiwan, R.O.C. TEL 886-2-2383-2331 FAX 886-2-2370-8775 EMAIL: sentech0501@yahoo.com.tw